

# **HSM 09Q - Data sheet**

#### **Electric data**

Value	Unit	Winding
		Pa (400VAC)
Number of poles		20
Number of pole pairs		10
Inductance/Phase	mH	2.7
Resistance/Phase	Ohm	1.0
Resistance/Phase-Phase	Ohm	2.0
Back EMF/Phase-Phase RMS	Vs/rad	0.76
Back EMF @ 1000 rpm	V	80
Torque constant (RMS)	Nm/A	1.32
Max rail voltage	V	750
Recommended peak current	Α	18
Torque at recommended peak current	Nm	18



# Mechanical data (resolver feedback)

Value	Unit	Singelturn		Multiturn	
	no brak		brake	no brake	brake
J	kgcm2	10.0	-	10.5	-
Mass	kg	4.6	_	4.9	-

#### **Holding brake**

Holding brake is not available as standard for HSM-motors. For custom solutions please contact HDD.

#### **Thermistors**

One on each ph	nase.
R @ 25 C	100 to 350 Ohm
R @ 145 C	< 1650 Ohm
R @ 155 C	> 4 kOhm

Overheat protection consists of triple PTC thermistors

## **Protection class**

HDD motors comply with the requirements for IP 65. IP-67 is available on request.

### **Insulation class**

The insulation system complies with the requirements of EEC LV Directive 73/23/EEC and 93/68/EEC. Test report E9911111E01.

#### Motor name structure

Туре		Stator length	Winding	Feedback	Power connector	Brake	Shaft	Options
HSM	09	- Q	- Pa	- EC	-A	-A	-A30	-AAA

Type HSM = Hollow Shaft Motor Flange size Approximate in cm. 09 = 92 mm. Stator length J (shortest), N, Q (longest). Winding Suitable rail voltage at 2000 rpm.

> Pa 560V

**Feedback** EC = Endat ECI 119. Other options available on request.

Power connector Many different pinouts available; see www.hddservo.com/product-options/


**Brake** A = no brake. No other option available for HSM motors as standard. Shaft A30 =  $\emptyset$ 30 thru hollow shaft. Other options available on request.

AAA = standard. For other options please contact HDD. **Options** 

#### **Torque**

Torque in Nm at 90°C temp rise (median temp rise, i.e. average between min and max temp for 25% cycle).

Duty cycle	100%	25%
100rpm	6.5	12.1
1000rpm	6.1	12.1
2000rpm	4.8	11.3
3000rpm	3.7	10.8

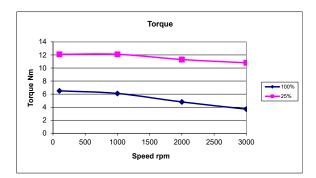

#### Current

Current at 90°C temp rise, in Ampere rms.

Winding	Pa		
Duty cycle	100%	25%	
100rpm	5.3	10.7	
1000rpm	4.8	10.4	
3000rpm	3.0	9.6	


Data were measured on an HSM 09Q-Pa series motor mounted on a vertical 260 x 200 x 12 mm aluminum plate in free air, with a winding temperature rise of 90°C and driven by a commercially available inverter.

#### Important note on peak torque and currents

The HSM motors are capable of high peak torques. At very high peak torques the permitted pulse time is very limited as a high current in a very small motor causes rapid temperature rise in the copper winding. The protection thermistor will not react fast enough to protect the winding during high pulse loads. A 25A rms current to a HSM09Q-Pa will give some 24Nm, but the copper winding temperature will increase with some 28°C per second. This is not a problem for short pulses of < 0.5 seconds as long as the rms value of the current is kept below some 5 A. The short term torque graph below represents acceleration ramps at various commanded currents.


#### Torque at various commanded currents

HSM 09Q-Pa at 560V rail voltage

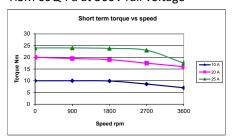

#### kT derating factor

Low speed, HSM09Q-Pa

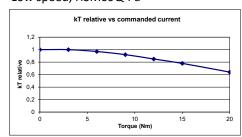

# Maximum load on shaft at life expectancy 20,000 h (shaft motors only)

Maximal axial load (push): 1600 N at 500 rpm, 650 N at 3000 rpm. Maximal axial load (pull): 50 N at all speeds. Maximal radial load at zero axial load is given by the curves below. For special cases please contact HDD for calculations.

